

**Madison Air Center Maintenance Service**

P.O. Box 950  
Madison, MS 39130

# Invoice

Date	Invoice #
9/4/2015	3238

Bill To
Larry Accardi 909 LaRoche Court Ridgeland, MS 39157 N2693B

Item	Quantity	Description	Rate	Amount
LABOR 630979-9 640612 MS35769-11 ARB3-5-1 MS29513-237 CH48108-1 X/C- 20/50	60 24 12 4 2 1 2 22	1. Discrepancy: 100 Hour/Annual Inspection due. Corrective action: Complied with 100 Hour Inspection in accordance with manufacturer's 100 Hour Inspection Checklist. Performed Annual Inspection in accordance with 14 CFR 43 App D. LABOR PER HOUR O RING WASHER CRUSH GASKET FILTER O-RING OIL FILTER X/C-20/50	90.00 2.57 0.60 1.07 4.02 1.73 28.20 5.15	5,400.00 61.68T 7.20T 4.28T 8.04T 1.73T 56.40T 113.30T
LABOR	0	2. Discrepancy: Differential Compression Check due. Corrective action: Performed differential compression check. Results as follows: Left: 1) 72/80 2) 78/80 3) 61/80 4) 65/80 5) 72/80 6) 64/80 Right: 1) 62/80 2) 76/80 3) 70/80 4) 64/80 5) 78/80 6) 73/80 LABOR PER HOUR	90.00	0.00
LABOR	0	3. Discrepancy: ELT operational check and inspection due as per 14 CFR 91.207(d). Corrective action: Performed operational check and inspection of ELT in accordance with 14 CFR 91.207(d). No discrepancies. LABOR PER HOUR	90.00	0.00
LABOR	2	4. Discrepancy: Left engine inboard lower cowling damaged. Corrective action: Fabricated repair doubler from 2024-T6.025 aluminum sheet and installed using MS20470AD-3-3 rivets. LABOR PER HOUR	90.00	180.00

<b>Total</b>
--------------

**Madison Air Center Maintenance Service**

P.O. Box 950  
Madison, MS 39130

# Invoice

Date	Invoice #
9/4/2015	3238

Bill To
Larry Accardi 909 LaRoche Court Ridgeland, MS 39157 N2693B

Item	Quantity	Description	Rate	Amount
URHB32E	6	5. Discrepancy: Inspect all spark on left and right cylinders. Corrective action: Six plugs failed inspection on right side, two plugs failed on left side. SPARK PLUG	27.94	167.64T
RHB32E	2	SPARK PLUG	33.34	66.68T
LABOR	0	LABOR PER HOUR	90.00	0.00
LABOR	2.5	6. Discrepancy: Aileron trim actuator locked in full right aileron trim position during operational check. Corrective action: Removed aileron trim push/pull rod and adjusted aileron trim. Reinstalled aileron push/pull rod and rigged aileron trim. Reinstalled associated hardware and fasteners. LABOR PER HOUR	90.00	225.00
LABOR	3	7. Discrepancy: AD 2000-01-16 Inspection due. Corrective action: Removed tail pipes on both left and right engines for inspection per AD 2000-01-16, no discrepancies noted. Reinstalled tail pipes. LABOR PER HOUR	90.00	270.00
49-75	1	8. Discrepancy: Rear cabin door support cable frayed. Corrective action: Removed and replaced cable. Adjusted travel. CABLE	187.44	187.44T
FREIGHT	1	FREIGHT AND DELIVERY	12.18	12.18
LABOR	0.5	LABOR PER HOUR	90.00	45.00
		9. Discrepancy: Pilot's P.T.T inoperative. (Cost from Cessna, \$330.00) Corrective action:		

<b>Total</b>
--------------

**Madison Air Center Maintenance Service**

P.O. Box 950  
Madison, MS 39130

**Invoice**

Date	Invoice #
9/4/2015	3238

Bill To
Larry Accardi 909 LaRoche Court Ridgeland, MS 39157 N2693B

Item	Quantity	Description	Rate	Amount
1102926 LABOR	1 1.5	Removed switch housing, milled out to accommodate a different brand switch. Soldered wires onto new switch and installed into yoke. MIC SWITCH LABOR PER HOUR	26.10 90.00	26.10T 135.00
08-06036 LABOR	1 0.25	10. Discrepancy: Central instrument air filter due replacement. Corrective action: Installed new filter. FILTER LABOR PER HOUR	59.93 90.00	59.93T 22.50
LABOR	2	11. Discrepancy: Right engine outboard lower cowling worn. Corrective action: Fabricated repair doubler from 2024-T3.025 aluminum sheet and installed using MS20470AD3-3 rivets. LABOR PER HOUR	90.00	180.00
C166001 FREIGHT LABOR	1 1 4.75	12. Discrepancy: Oxygen hydrostatic interval expired 3/2015. Corrective action: Removed bottle, disassembled, boxed and shipped for hydrostatic test to Bacon Equipment. Reassembled bottle, leak checked, purged and reinstalled into aircraft. HYDROSTATIC TEST FREIGHT AND DELIVERY LABOR PER HOUR	63.00 23.21 90.00	63.00T 23.21 427.50
LABOR	1	13. Discrepancy: Co-pilot's seat adjustment inoperative. Corrective action: Installed new set screws in seat back adjustment cable. LABOR PER HOUR	90.00	90.00
MISC. SHOP ...	1	MISC. SHOP SUPPLIES	156.68	156.68

<b>Total</b>
--------------

**Madison Air Center Maintenance Service**

P.O. Box 950  
Madison, MS 39130

# Invoice

Date	Invoice #
9/4/2015	3238

Bill To
Larry Accardi 909 LaRoche Court Ridgeland, MS 39157 N2693B

Item	Quantity	Description	Rate	Amount
		MS USE TAX ON PARTS	7.00%	57.64

<b>Total</b>	<b>\$8,048.13</b>
--------------	-------------------