

AD NOTES COMPLIANCE RECORD

Airframe - Cessna - U206-G

U20603730

Manufacture date 03/15/1977

Engine - Continental Motors - IO-520-F

570183

Propeller - McCauley - D3A32C90

771299

Appliance - Air Filter - Brackett

Appliance - Ignition Switches - ACS

AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	Recurring	Next Comp. @ Hrs/Date	Authorized Signature & Number
77-16-05	Fuel selector valve	8-3-77 TT 11.9		X		P/C/W	
79-05-09	Oil pressure relief valve	2-22-80 TT 374		X		P/C/W	
79-08-03	Electrical system	2-21-80 TT 374		X		P/C/W	
79-15-01	Fuel flow distribution	2-22-80 TT374		X		P/C/W	
84-10-01 R1	Bladder fuel cells	9-12-84 TT1104	Drain kits SK206-24 and SK206-25 installed 9-12-84 tach time 1104.0		X	P/C/W	
85-02-07	Fuel selector	3-20-85 TT1214.		X		P/C/W	
85-08-08	Propeller hub cracks	8-23-96 ACTT 2411.		X		P/C/W	
85-10-02	Engine induction airbox	8-30-24 tac 238.7	C/W by inspection.		X	Due ea 100hrs (tac 338.7)	
88-19-11	Contaminated fuel	10-29-86 TT 1476		X		P/C/W	
93-05-06	ACS ignition switches	3-10-2018 TT 3817.4	C/W 3-10-2018 tach 1605.3 ACTT 3817.4. Installed switch kit p/n C292501-0106.		X	DUE EACH 2000HRS (TT 5817.4 tac 3805.3)	
96-12-22	Oil filter adapter	8-30-24 tac 238.7	Due ea. 100hrs or oil change.		X	(b)(2) due each 100hrs (tac 338.7)	
97-01-13	Fuel, oil, or hydraulic hose	9-1-97 TT2506		X		P/C/W	
97-26-17	CORRECTION - Crankshaft fatigue cracks	7-3-2010 tac 1145.1	VAR CRANKSHAFT INSTALLED		X	DUE AT EACH CRANKSHAFT REMOVAL	
99-04-04	Magneto impulse coupling	n/a by engine model	n/a by engine model.		X	n/a	
99-24-10	Standby vacuum system	N/A BY STC #			X	n/a by stc #	
2004-08-10	Prevent loss of engine power	n/a by OH date	n/a by OH date and cylinder s/n's. See engine logbook for s/n's. Overhaul date 7/3/2010.	X		n/a	
2005-11-06	Correct problems with the SVS before failure or malfunction	Deactivate d.	See instructions for continued airworthiness in aircraft records. Installation instructions no.08074. SVS-VI valve installed 7-14-2005. Para (e)(1), (e)(2) and (e)(3) c/w 7-14-2005.		X	N/A Valve removed. System deactivated.	Sheldon A Burgess A&P 2159379
2008-10-02	To prevent erroneous indications from the altimeter, airspeed, and vertical speed indicators	5-20-08 tac. 1037.6	Static alternate air outlet not obstructed.	X		n/a by p/n	
2008-26-10	Correction - Prevent erroneous indications from the altimeter, airspeed, and vertical speed indicators	n/a by p/n	n/a by p/n.		X	n/a by p/n	
2009-16-03	To prevent the separation of the cylinder head	n/a by p/n	n/a. SAP cylinders not installed. (ECI Nickel Cylinders installed. p/n AEC631397, TISN71.4BCA.)		X	n/a	

AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	Recurring	Next Comp. @ Hrs/Date	Authorized Signature & Number
2009-19-07	Correction - To prevent loss of engine power due to cracks in the cylinder head, possible engine failure, and fire in the engine compartment	n/a by p/n	n/a Teledyne continental cylinders not installed. (ECI cylinders installed.)		X	n/a	
2009-26-12	To prevent loss of engine power due to cracks at the head-to-barrel interface and possible engine failure caused by separation of a cylinder head	n/a by eng. model	n/a by engine model. Lycoming engine not installed.		X	n/a	
2010-11-04	To prevent excessive hydraulic lifter wear	n/a by p/n	n/a by p/n. Lifter p/n's 628488 and 646277 installed.		X	n/a by p/n	
2011-10-09	To prevent seat slippage or the seat roller housing from departing from the seat rail	8-30-24 tac 238.7	C/W by inspection.		X	Due ea. 100hrs or 12 months.	
2011-26-07	To prevent engine failure due to migration of the magneto impulse coupling stop pin	n/a by engine model	n/a by engine model.		X	n/a	
2012-03-06	To prevent an in-flight shutdown due to a failed fuel servo diaphragm	n/a by date	n/a by date and fuel system installed.		X	n/a	
2014-05-29	Superior Air Parts Investment Cast Cylinder Assemblies	n/a by p/n	n/a by p/n. Superior Air Parts cylinders not installed. ECI Nickel Cylinders installed p/n AEC631397 at overhaul. 7/3/2010.		X	n/a	
2018-16-12	ECI Class 71 or Class 76 Cylinder Assembly Failures	n/a by s/n	n/a by cylinder s/n's. ECI p/n AEC631397 cylinders installed. s/n 63886-10, 63024-21, 66620-19, 66295-17, 64246-29 and 64246-14.		X	n/a	
2020-18-01	Forward Cabin Doorpost Bulkhead Cracking	8-30-24 tac 238.7 TT4183.0	C/W by inspection. No cracks found.		X	Due ea 36 months or 1000hrs Due 8-30-2027 or TT 5183.0	
2022-04-04	STC Stratus Oil Filter Adapter Fiber Gasket Oil Loss	n/a by p/n	n/a STC not installed.		X	n/a	
2022-16-03	S-1200 Series Magnetos Roller Bearings Improper Lubricatio	n/a by model	n/a by magneto manufacturer.		X	n/a	
2023-02-12	Intake Valve Failures	n/a by p/n's	n/a by p/n's Superior Air Parts cylinders not installed.		X	n/a	
2023-05-16	Improper Installation of Counterweight Retaining Rings	n/a by date	n/a by date of overhaul. 7-3-2010.		X	n/a	
2023-09-09	Failures of Spot-Welded, Multi-Segment V-Band Couplings	n/a part not installed.	n/a Part not installed.		X	n/a	