

LH

ENGINE LOG BOOK



Service Information

Consult the Continental Motors web site at continentalmotors.aero for engine related news or announcements. Continental Motors Internet Service contains useful information for Continental Motors engine owners, including electronic versions of the most current engine Instructions for Continued Airworthiness and service documents that may be pertinent to your engine model.

If Internet access is not available, contact our Customer Service Department at:
1-888-826-5465 Toll free in the United States or
1-251-436-8299 International

Engine Returns

Return engines for core credit with this log book to:

Continental Motors, Inc.
2039 Broad Street
Mobile, AL 36615 USA

Return engines for overhaul with this log book to:

Continental Motors, Inc.
Factory Service Center
8600 County Road 32
Fairhope, Alabama 36532 USA

**USE ONLY FUEL SPECIFIED IN OPERATOR'S
MANUAL OR TYPE CERTIFICATE DATA SHEET
USE OF AUTOMOTIVE FUEL IS PROHIBITED**



Continental Motors

FAA PRODUCTION CERTIFICATE NO. 508

Printed: 05/16/2017

Test Date: 05/16/2017

This engine model I0550C49B, serial number 1034034 was manufactured by Continental Motors, Inc. in accordance with approved design data and the applicable requirements of 14 CFR, Part 21. The approved design data for this engine incorporates all changes required by applicable FAA Airworthiness Directives and Continental Motors Service Bulletins.


CONTINENTAL MOTORS, INC.

Engine Service and Maintenance Record

Date	Total Time		Time Since Last Overhaul		Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins
	Hours	Min	Hours	Min	
7-20-17	379.0		T.T. 0.0		<p>Left Engine Log Entry 7-20-17 N584DW Continental IO-550-C49B SN 1034034 Hobbs 379.7 TT 0.0</p> <p>Installed this factory new engine on left position of Beech G58 SN TH-2394. Serviced with Aeroshell 100 mineral oil. Installed Continental oil dipstick PN 652171-5. Installed overhauled prop governor PN B210800, SN 00718. Installed new oil hoses PN 111F417-6S0260 and 130F003-4S0150. Ran up and checked for leaks.</p> <p><i>Douglas Spillers</i> Douglas Spillers A&T 3191078</p>
<p><i>Left Engine, 10-11-17 Hobbs 399.0</i> <i>Changed oil and filter, Phillips 20W50. Ran up OK.</i></p> <p><i>Douglas Spillers</i> <i>A&T 3191078</i></p>					
<p>N584DW LEFT ENGINE LOGBOOK ENTRY 4-3-2018 HOUR METER 424.0 ENGINE TOTAL TIME IN SERVICE 44.3</p> <p>Oil filter inspected, no metal found. New oil filter installed. Checked compression: (1) 78/80 (2) 72/80 (3) 78/80 (4) 76/80 (5) 78/80 (6) 74/80. Serviced engine with 10qts. Phillips 20 w 50 oil. Replaced air filter, P/N P128167, due each 500hrs per AD. Cleaned and gapped spark plugs. Engine washed and ground run, operational check OK, no leaks noted.</p> <p>I certify that this ENGINE has been inspected in accordance with an ANNUAL INSPECTION and found to be in airworthy condition.</p> <p>David Townes Cox IA 2679578 <i>David Townes Cox</i></p>					

Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record
	Hours	Min	Hours	Min	Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins
Carried forward					
					<p>Left Engine N584DW Hobbs 468.5 10-15-18 Changed oil and filter. Phillips 20W50. Inspected filters, No metal. Ran up OK <i>Ronny Spill</i> ATA 3191078</p>