

Section 1: Airframe Log

DATE / /	AIR TIME				LANDINGS / CYCLES		DETAILS OF TASK (INSPECTION, REPAIRS & REPLACEMENT)
	DAILY TOTAL		TOTAL		DAILY TOTAL	TOTAL	
	HRS	MIN	HOURS	MIN			
CARRIED FORWARD							



Make: Beech
Model: Bonanza F33A
Serial No: CE-1170
Registration: N133GM

Date: 10/07/2015
Work Order: 2631
Tach: 753.0
Hour Meter: 3460.7

Removed elevators, rudder, ailerons and flaps. Chemically stripped paint from aircraft. Removed all external corrosion. Acid etched and treated aircraft skin. Applied Sherwin Williams epoxy primer and polyurethane topcoat. Flight controls checked for proper balance in AWW manufacturer's specifications. Added weight to both ailerons to bring within limits. Installed new wing and stabilizer root seals p/n's 115092 and 111722. Sealed windshield and cabin windows. Reinstalled flight controls and flaps. All work accomplished in accordance with 14 CFR Part 43. Aircraft approved for return to service with respect to the work performed.

Primers: SW CMO483660 & CMO560566
Base Color: SW Jet Glo Exp. Matterhorn White #00150
1st Stripe Color: SW Acry Glo Black Velvet #10684
2nd Stripe Color: SW Acry Glo Las Vegas Gold #10494

Murmer Aircraft Services
 503 McKeever Rd. #1504
 Arcola, TX 77583
 FAA CRS: GG2R845K

Authorized Signature: *Ann Johnson*

Madison Air Center, 7450 Old Canton Rd., Madison, MS, 39110 (601) 853-9358

Airframe Maintenance Record Entry November 2
N133GM Beech F33A serial CE-1170
Tach 719.9 Hour Meter and Total Time 3426.3

Maintenance Actions

- 1) Performed 100 hr/annual inspection/maintenance in accordance with Hawker Beechcraft Bonanza Series 100 HR or Annual Inspection Checklist.
- 2) Performed operational check of ELT in accordance 14 CFR 91.207(d). Expiration date JUNE 2016. No defects noted at this time.
- 3) Performed Differential Compression Check. Results as follows: 1) 70/80, 2) 70/80, 3) 76/80, 4) 74/80, 5) 76/80, 6) 72.
- 4) Install overhauled flap motor assy pn D160-00-3 sn 1977. Unit was overhauled by George's Electrical Service, CRS NP3R718L on work order 19987 dated 16 June 2015. Adjusted limit switches. Operational check, OK.
- 5) Installed new BA-7112 Brackett induction air filter.
- 6) Changed oil, cut open filter and inspected for metal, none found. Service with 11 qts. Phillips X/C 20W50 and 1 ea CH48109-1 filter and added one bottle Camguard.
- 7) Removed battery box, cleaned corrosion, painted and reinstalled.
- 8) Installed new landing light bulb pn 4596
- 9) Bled brakes.

<continued>

PAGE TOTALS

CARRY FORWARD to Top of Next Page